


Unit 1 to Terminal Board 1



WPU Wiring Diagram_18E1C4D/460-3-60.AC

S.N	Label	Description	S.N	Label	Description
1	TK	Fan overload	13	HP	High pressure switch
2	FV	Brown-out circuit used for compressor protection	14	KM2	Electric heaters AC contactor
3	KA3	Compressor pilot relay	15	KM1	Compressor AC contactor
4	KA4	Heater pilot relay	16	MC	Compressor
5	HP1	Condenser fan switch	17	MF3/MF4	Evaporator fan/Supply fan
6	EH1-3	Electric heaters	18	MF1	Condenser fan
7	EH	Crankcase heater	19	FT	Compressor overload
8	FU	Thermal fuse for heating	20	TK1	Condenser fan overload
9	TW	Temperature switch for heating	21	YE	Air damper actuator
10	PF	Air pressure differential switch	22	QF	Breaker
11	TC1	AC transformer	23	R	Resistance
12	LP	Low-pressure switch	24	TB1&TB2	Terminal Board (CA1-5 Connection)

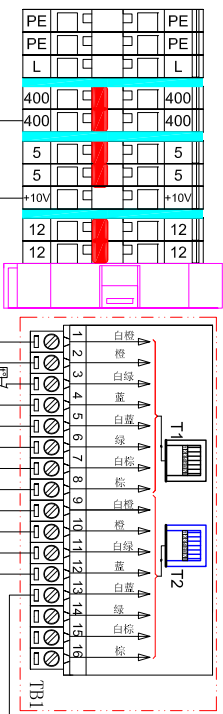